
UNCONTROLLED COPY



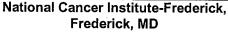

**STANDARD OPERATING PROCEDURE**  **Effective Date** 

FEB 1 3 2009

**Procedure Number** 

22918

Page 1 of 3

Revision 01

**Biopharmaceutical Development Program** 

Title: Glassware Cleaning for Trace TOC Analysis

Author/Date:

Approvals/Date:

SOP References: 22917

Supersedes: Revision 00

Purpose: The objective of the Glassware Cleaning Procedure is to minimize carbon contamination on glassware and closures used to collect, transfer, or store reagents and standards for trace TOC determination. This procedure uses a dilute nitric acid soaking to clean the containers.

Scope: This procedure applies to glassware, containers and closures that come in contact with standards, or reagents used during Total Organic Carbon analyses only. This includes reagent and calibration standard solution bottles. volumetric glassware used to make standards and all closures for these containers.

### Contents:

- 1.0 Authority and Responsibility
- 2.0 Definitions
- 3.0 Materials and Reagents
- 4.0 Procedure
- 5.0 References
- 1.0 Authority and Responsibility
  - 1.1 The Director, Process Analytics (PA) has the authority to define this procedure.
  - 1.2 PA personnel are responsible for implementation and performing this procedure. This includes training of personnel in performing this testing.
  - 1.3 Biopharmaceutical Quality Assurance (BQA) is responsible for quality oversight of this operation.

1.4

V:\QA\_Public\Documentation\Standard Operating Procedures\22000 SOPs\22900 Series\22918\Effective\Effective SOP 22918 Rev 01.doc

UNCONTROLLED COPY





**Biopharmaceutical Development Program** 

# STANDARD OPERATING PROCEDURE

**Effective Date** 

Feb. 13, 2009

22918

**Procedure Number** 

Page 2 of 3

Revision 01

Title: Glassware Cleaning for Trace TOC Analysis

## 2.0 <u>Definitions</u>

2.1 Reagent Water

The reagent water used must be of the highest quality deionized, distilled or reverse osmosis water available, containing no more than 0.1 ppmC for low level analysis. See *SOP 22917, Operation of the Phoenix 8000 TOC Analyzer*, for a list of sources that provide water of this quality.

### 3.0 Materials and Reagents

3.1 Reagent Water

RODI water shall be used in the preparation of the nitric acid solution, but reagent water shall be used in all final rinse of glassware being cleaned.

**NOTE**: If using packaged sterile WFI, ensure that a Certificate of Analysis is provided and is kept on record in the appropriate files.

3.2 Nitric Acid (BDP part number: 3060110122) HNO<sub>3</sub>

3.2.1 Grade

**ACS Reagent Grade** 

3.2.2 Stock Concentration

70%

3.2.3 Working Concentration

0.5%

3.3 TOC Sampling Containers (BDP part # 20442)


#### 4.0 Procedure

4.1 For new use of dedicated equipment only, wash all glassware, containers, and closures with hot tap water and Contrex (BDP part # 30783).

**NOTE**: For glassware that has been previously used for TOC analysis (excluding sample vials), proceed to paragraph 4.3.

- 4.2 Rinse profusely (5 times) with RODI water.
- 4.3 Soak all glassware, containers, and closures in dilute (0.5%) nitric acid solution for a minimum of 8 hours or overnight. Glassware maybe stored in this solution until ready for use.

UNCONTROLLED COPY

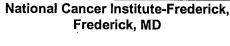



STANDARD OPERATING PROCEDURE Effective Date

Procedure Number

Feb. 13, 2009

22918

Page 3 of 3

**Revision 01** 

Biopharmaceutical Development Program

Title: Glassware Cleaning for Trace TOC Analysis

4.3.1 Dilute 1 part Nitric Acid 70% to 139 parts Reagent water. Example: add 1mL of Nitric acid to 139mL of reagent water.

- 4.3.2 Fill the glassware and containers completely with the dilute acid to soak.
- 4.3.3 Place the closures and septa on their respective glassware/containers and leave to soak in this state for required time.
- 4.4 Rinse profusely (4 times) with RODI water and final rinse with reagent water for a minimum of 5 rinses.
- 4.5 Once the glassware is clean store it in a clean dry area that is labeled "Cleaned glassware for TOC analysis only." Be sure that glassware is covered to help ensure that the glassware stays clean.

## 5.0 References

- 5.1 Phoenix 8000 User Manual, Part Number 14-7045-074
- 5.2 USP Method <643>, Total Organic Carbon
- 5.3 USP Method <1051>, Cleaning Glass Apparatus
- 5.4 ASTM D1193, Standard Specification for Reagent Water
- 5.5 Eagle Pitcher Industries, Miami, OK, 800-331-7425